

Car Testing

Work Order ID 152121

152121

Thursday, October 20, 2016 11:10:14 AM

Item ID: D412-596-203TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Aft Extended Turning Detail
Start Date: 11/1/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/7/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference: D412-596-203

Approvals: Process Plan: VS Date: 16/10/20 Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
100	*100* Mori Seiki Mori Seiki CNC Lathe Large	0.07				<u>1</u>	<u>Ø</u>		DAS 23 9-89
	Rev. B								
	MORI SEIKI CNC LATHE LARGE								
	Memo	0.68							
	1-Cut tube on chop saw, leave extra mat'l for facing and install plugs 412-203 on both ends.								
	2-Face both sides of tube.								
	3- Turn program 02000 section on both side as per folio FB177.								
	4- Turn program 03000 section on both side as per folio FB177.								
	5- Blend transsition lines only with belt sander 60 grit								
	Folio rev: _____								
	Dwg rev: _____								
110	*110* QC Quality Control	0.00				<u>1</u>	<u>Ø</u>		DAS 23 9-89
	QC2- Inspect parts off machine FAI/FAIB	0.00							
	Memo	0.00							

17/2/14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
270 CS 28 R				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Thursday, October 20, 2016 11:10:14 AM

152121

Page 2

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 11/1/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 11/7/2016 **Req'd Qty:** 1.00 *** 1 ***

Customer:

Reference: RD16-682-01

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

**Insp.
Stamp**

0.00

120

MORI SEIKI CNC LATHE LARGE

0.54

Mori Seiki

Mori Seiki CNC Lathe Large

Memo

1- Turn program 04000 section on both side as per folio FB177.

2- Turn program 05000 section on both side as per folio FB177.

3- Blend transsition lines only with belt sander 60 grit

4-Scribe part # as per Dwg D412-596-203

Folio rev:

Dwg rev: _____

DAS
23
9-89

17/2/10

130

QC2- Inspect parts off machine FAI/FAIB

0.00

130

QC

Memo

0.00

Quality Control

PERFORME ULTRASONIC MEASUREMENT

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
2AO CS 98-2				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☒

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
Add Sequence ISO ↳ Grind Machining Marks Longitudinally SAC TA 08-9		 1705-06 Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

Work Order ID 152121

Thursday, October 20, 2016 11:10:14 AM

152121

Page 4

Item ID: D412-596-203TRN**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** Crosstube Aft Extended Turning Detail**Start Date:** 11/1/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 11/7/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:** RD16-682-01**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start*****NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop*****NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

QC21- Final Inspection - Work Order Release

0.00

200

QC

Memo

0.10

Quality Control

DAS
21
9-89

MAR 08 2017

DAS
21
9-89

MAR 06 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Thursday, October 20, 2016 11:10:29 AM

Page 1

Work Order ID: 152121

152121

Parent Item: D412-596-203TRN

D412-596-203TRN

Parent Item Name: Crosstube Aft Extended Turning Detail

Start Date: 11/1/2016

Required Date: 11/7/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV: A NEW ISSUE JFS 13/03/22 VERIFY BY: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6020-160		Manufactured	No			100	Each	15.0000	1	1			

D6020-160

Crosstube Material

Location

Loc Qty

Loc Code

HALL

15

133623

15

17/2/9

DAS
23
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	☐	Past Due ☐							

DART AEROSPACE LTD	Work Order:	<i>152121</i>
Description: Crosstube Assembly (412 Hi Hi Aft)	Part Number:	D412-596-203
Inspection Dwg: D412-596-203 Rev: B		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	R0.50	+/-0.010	<i>R0.50</i>	✓		<i>RG tape</i> ↑	
	8.44	+/-0.060	<i>8.44</i>	✓			
	Ø3.250	+0.000/-0.010	<i>3.250</i>	✓			
	Ø2.875	+0.005/-0.000	<i>2.878</i>	✓			
	Ø2.875	+0.005/-0.000	<i>2.878</i>	✓			
	Ø2.935	+0.005/-0.000	<i>2.938</i>	✓			
	Ø2.999	+0.005/-0.000	<i>3.003</i>	✓			
	Ø3.063	+0.005/-0.000	<i>3.068</i>	✓			
	Ø3.125	+0.005/-0.000	<i>3.130</i>	✓			
	Ø3.250	+0.005/-0.000	<i>3.255</i>	✓			
						<i>Vernier</i>	
SIDE B	R0.50	+/-0.010	<i>R0.50</i>	✓		<i>RG tape</i> ↑	
	8.44	+/-0.060	<i>8.44</i>	✓			
	Ø3.250	+0.000/-0.010	<i>3.248</i>	✓			
	Ø2.875	+0.005/-0.000	<i>2.875</i>	✓			
	Ø2.875	+0.005/-0.000	<i>2.875</i>	✓			
	Ø2.935	+0.005/-0.000	<i>2.936</i>	✓			
	Ø2.999	+0.005/-0.000	<i>3.002</i>	✓			
	Ø3.063	+0.005/-0.000	<i>3.067</i>	✓			
	Ø3.125	+0.005/-0.000	<i>3.129</i>	✓			
	Ø3.250	+0.005/-0.000	<i>3.254</i>	✓			
						<i>Vernier</i>	
	151.38	+/-0.060	<i>151.36</i>	✓		<i>tape</i>	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

DART AEROSPACE LTD	Work Order:	152121
Description: Crosstube Assembly (412 Hi Hi Aft)	Part Number:	D412-596-203
Inspection Dwg: D412-596-203 Rev: B		Page 2 of 2

WALL THICKNESS MEASUREMENT

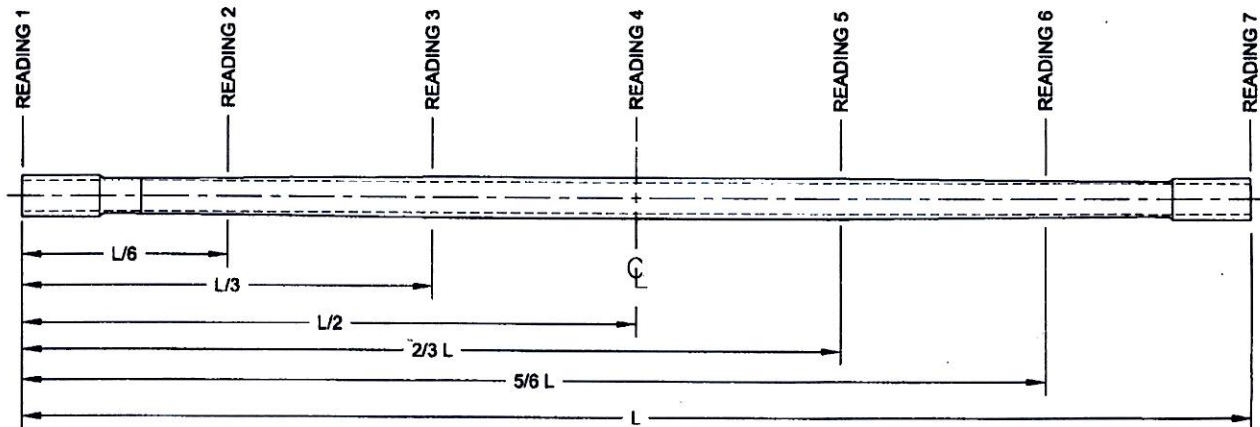

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	436	436	434	435	0.002	0.073
READING 2 L= 25.23	264	267	252	251	0.015	
READING 3 L= 50.46	341	345	338	335	0.005	
READING 4 L= 75.69	433	436	437	438	0.005	
READING 5 L= 100.92	335	336	344	346	0.011	
READING 6 L= 126.15	252	254	265	265	0.013	
READING 7 L= 151.38	431	433	434	435	0.004	

Calibration Result

Actual Block Thickness: 100.400

Sitescan 250 Measured Thickness: 100.400

DAS 23 9-89		DAS 47 9-89		Calibration Result Actual Block Thickness: 100.400 Sitescan 250 Measured Thickness: 100.400		
Measured by:		Audited by:		Preliminary Approval:		
Date: 17/2/16		Date: 17-03-02		Date:		
Rev	Date	Change			Revised by	Approved
A	15.04.27	New Issue			KJ	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective : 95				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
				47 DVE 0-60																																																													
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Item	Qty -203	Part Number	Description
1	X	D412-596-203	CROSSTUBE ASSEMBLY (412 HI HI AFT)
2	1	D6020-170	CROSSTUBE MATERIAL
3	2	D3595-063-530	RUBBER CUSHION
4	1	D4908-1	SUPPORT
5	2	D4910-1	CHAFING SHIELD
7	4	MS21920-26	CLAMP
8	2	MS21920-28	CLAMP
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890	SEALANT

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6020-170
FINISHED LENGTH = 151.38±0.060 (BEFORE BENDING/TRIMMING)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN B6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART P/N "D412-596-203" AND B/N ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 191.1 lb RAW MATERIAL, 118.3 lb AFTER MACHINING
118.0 lb FINISHED WEIGHT
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- BENDING**
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R35 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

ASSEMBLY

- 12) INSTALL D4908-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- 13) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D4908-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) IF NOT ALREADY PRESENT ON CHAFING SHIELD, APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D4910-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL D4910-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 15) TORQUE CLAMPS ON D4908-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D4910-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 152121

UNDER REVIEW OK
11/17/13 07/14/14
JRF 4-601

UNDER REVIEW
11/15/13
JRF 15-561

RELEASED
2013-08-06
JMD

B	ADD INSPECTION WINDOW (ZN C8-1, B6-2)	CP	13.06.16
A	NEW ISSUE	CP	13.03.13
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	13.06.16		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D412-596-203	REV. B SHEET 1 OF 4
TITLE CROSSTUBE ASSY (412 HI HI AFT)	SCALE NTS
COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS UNCLASSIFIED AND IS AVAILABLE FOR REUSE WITHOUT RESTRICTION IF IT IS NOT REPRODUCED FOR PROFIT OR FOR THE PURPOSES OF ANY OTHER PERSON OR ENTITY. REPRODUCTION OF THIS DOCUMENT IS PROHIBITED.	

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

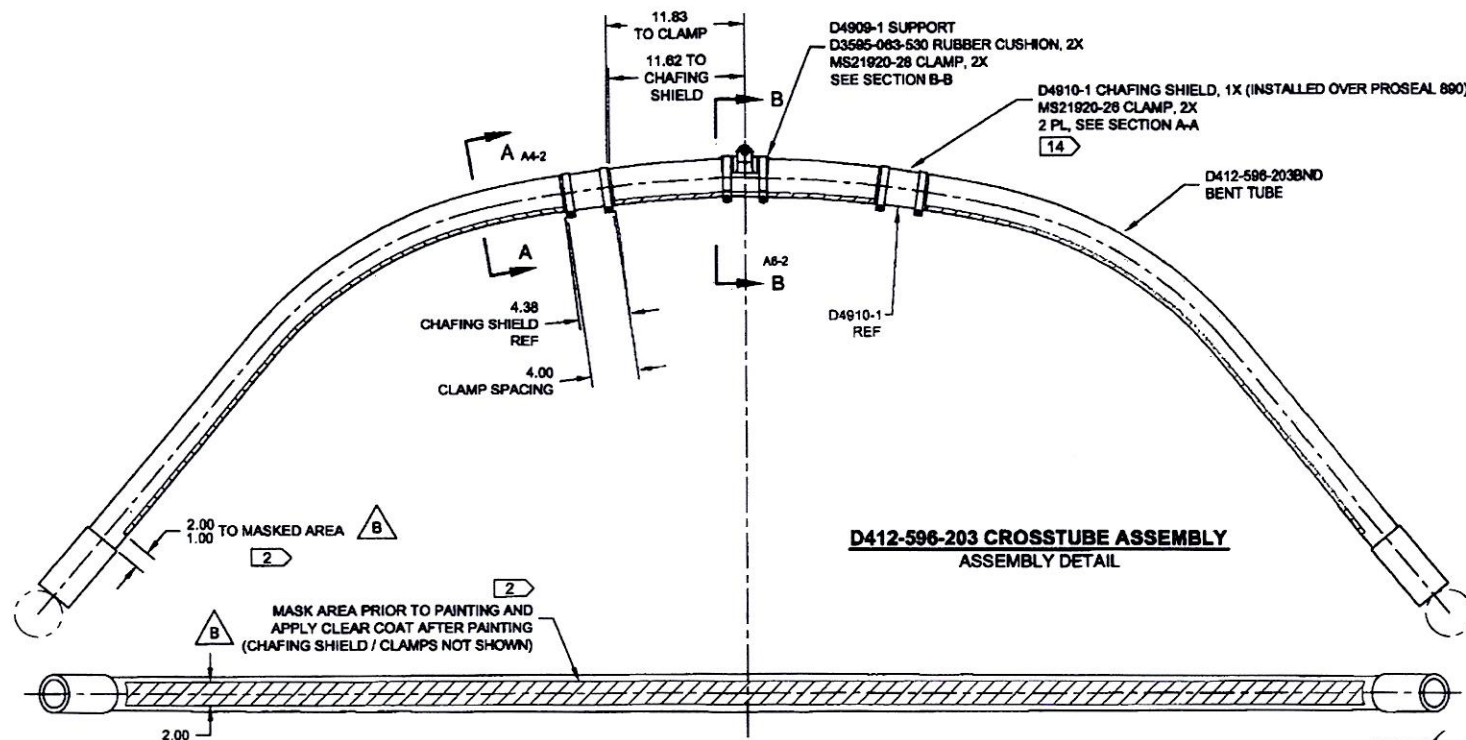


D412-596-203 CROSSTUBE ASSEMBLY
ASSEMBLY DETAIL

12
APPLY 3M SCOTCH-WELD DP480
BETWEEN D4909-1 SUPPORT AND
THE CROSSTUBE

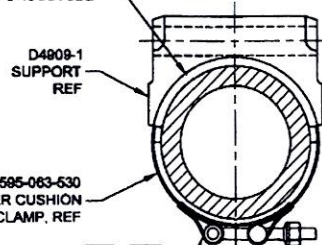

SECTION B-B D4-2
SCALE 4X

C
SYM

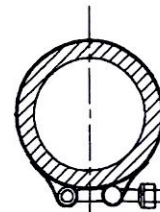

SECTION A-A C6-2
SCALE 4X

UNDER REVIEW
14/7/14

UNDER REVIEW
15/11/14

RELEASED
2013-08-06

DESIGN		DART AEROSPACE LTD
DRAWN		HAWKESBURY, ONTARIO, CANADA
CHECKED	A.P.	DRAWING NO. REV. B
MFG. APPR.		D412-596-203 SHEET 2 OF 4
APPROVED		TITLE SCALE
DE APPR.		CROSSTUBE ASSY (412 HI HI AFT) NTS
DATE	13.06.16	COPYRIGHT © 2013 BY DART AEROSPACE LTD

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

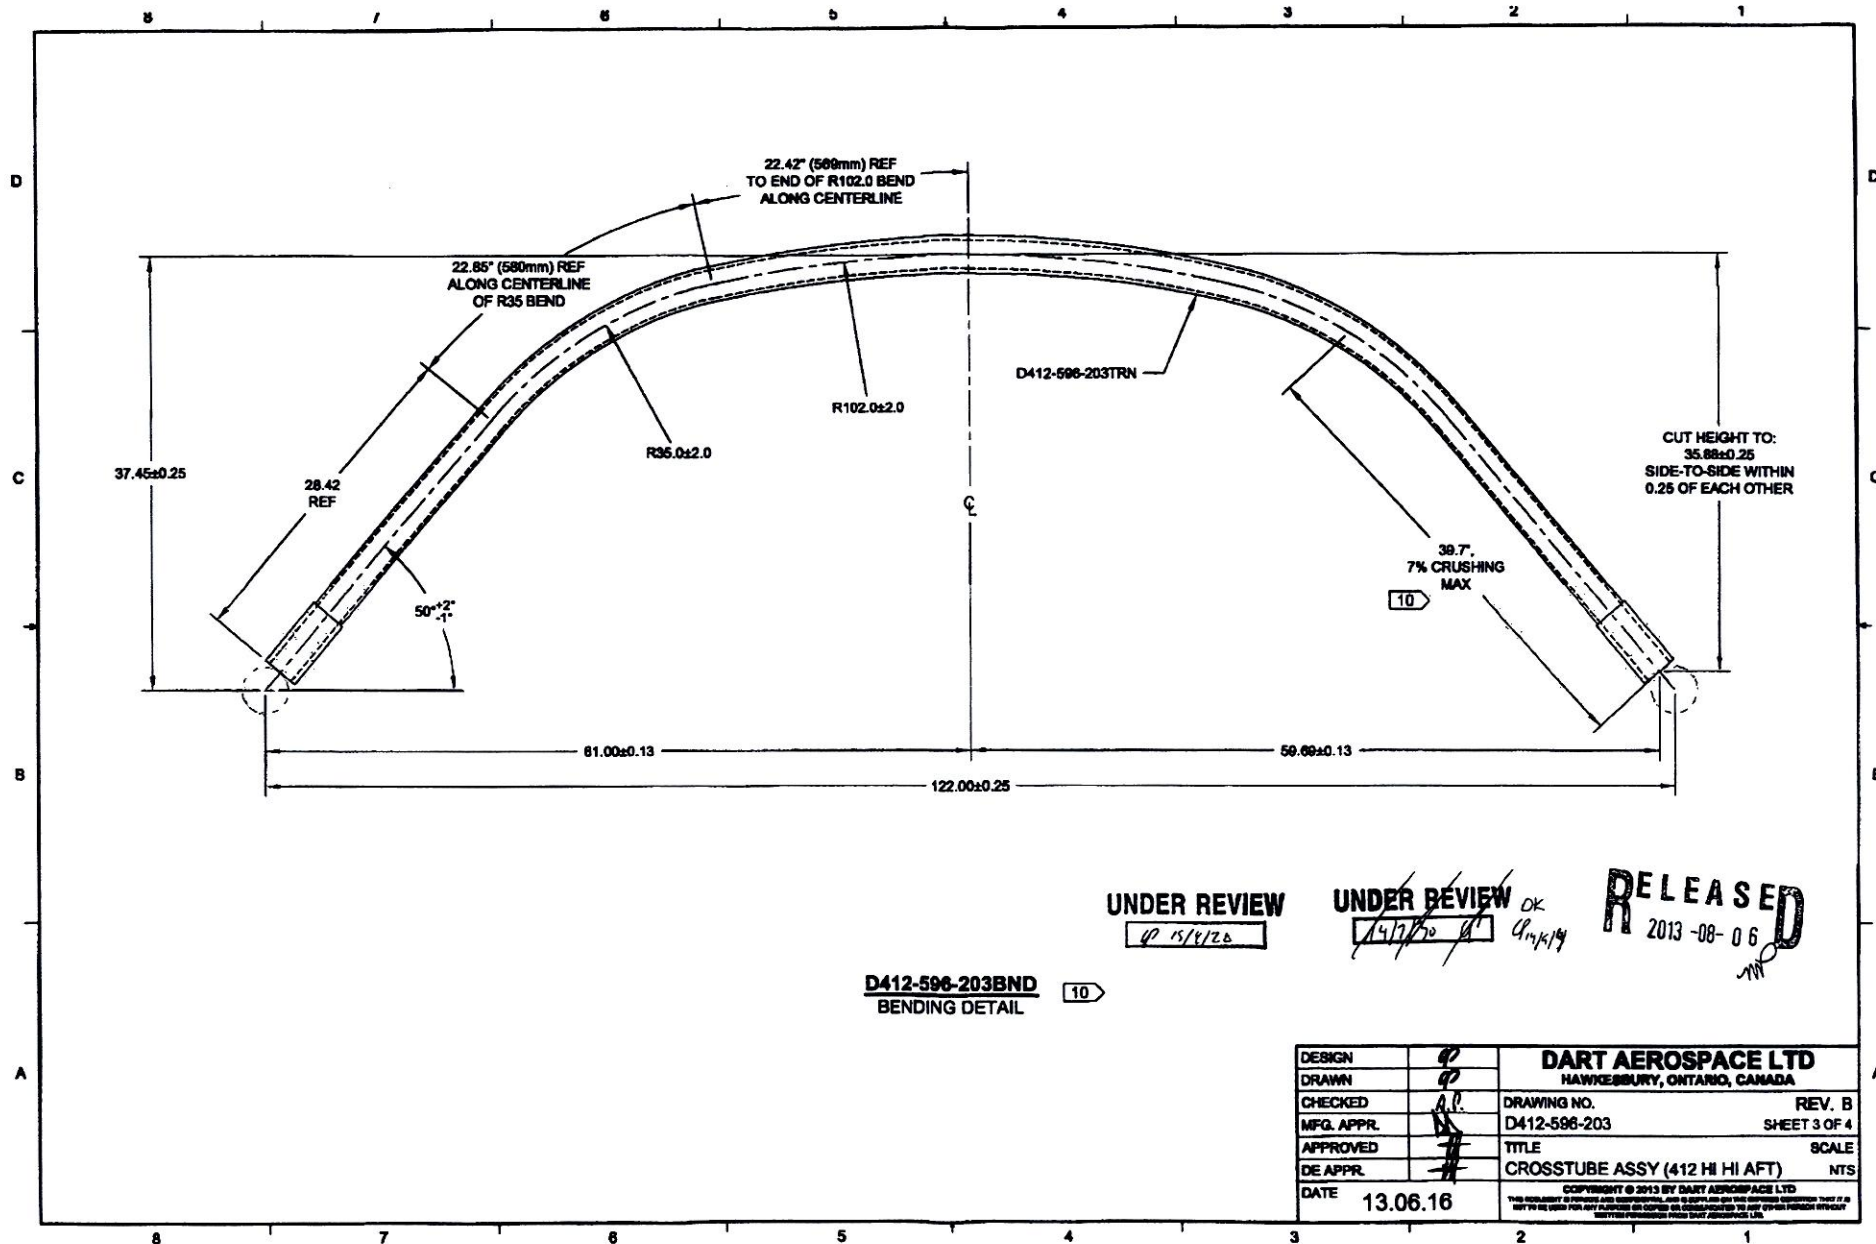

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER :							
Misidentified ☐	☐ Past Due								

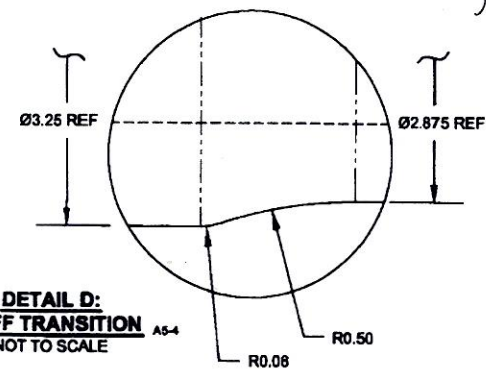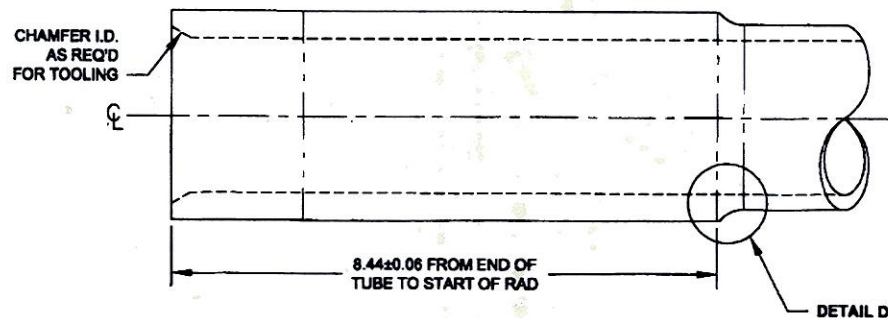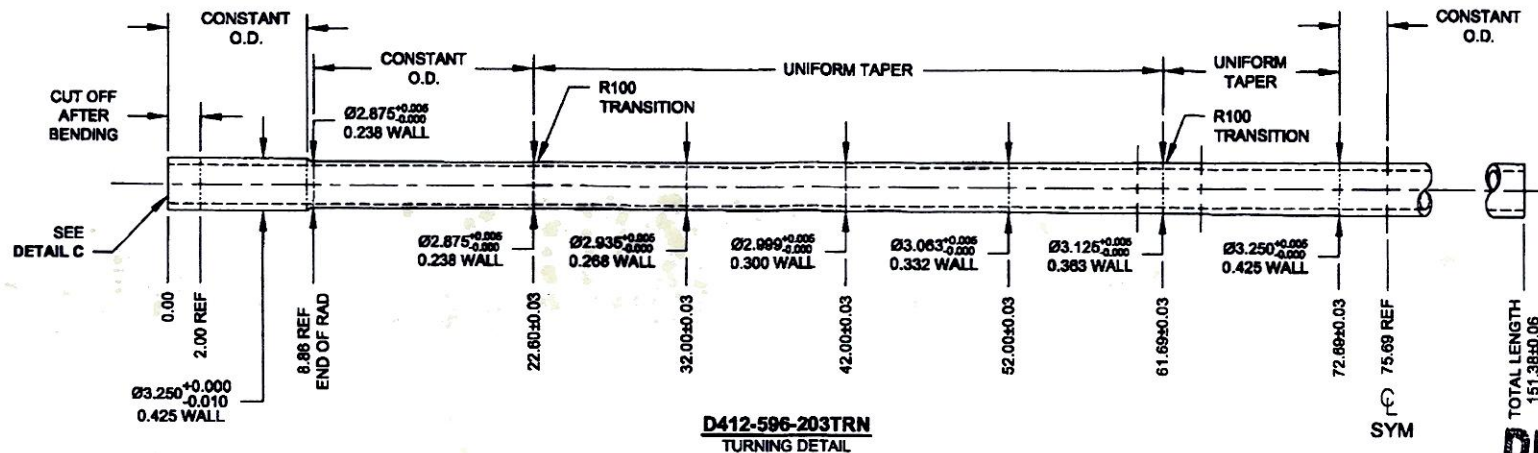

UNDER REVIEW

4/15/4/20

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. B
MFG. APPR.		D412-596-203	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSY (412 HI HI AFT)	NTS
DATE	13.06.16	COPYRIGHT © 2013 BY DART AEROSPACE LTD	

CK 4/14/4
 UNDER REVIEW
 2013-08-06

RELEASED
 2013-08-06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								